



BOONE
INDIANA
C O U N T Y

Boone County
Americans with Disability Act
ADA Transition Plan

Prepared by: DB Engineering

October 12, 2022

Table of Contents:

1. Introduction	Page 3
2. Transition Plan Development	Page 4
a. ADA Coordinator	Page 4
b. Grievance Procedure	Page 4-5
c. Self-Evaluation	Page 5-6
d. ADA Standards, Specifications, and Design Details	Page 6
e. Implementation	Page 6

Appendices:

Appendix A: Grievance Form	Page 7-9
Appendix B: Inventory of Outdoor Barriers	Page 10-23
Appendix C: Inventory of Indoor Barriers	Page 24-26
Appendix D: Sample Photos of Outdoor Barriers	Page 27-28
Appendix E: Sample Photos of Indoor Barriers	Page 29-30
Appendix F: INDOT Curb Ramp Standards	Page 31-32

Introduction

The Americans with Disabilities Act (ADA) was enacted on July 26, 1990, and later amended effective January 1, 2009. As written and implemented, the ADA provides comprehensive civil rights protections to persons with disabilities in the areas of employment, state and local government services, access to public accommodations, transportation, and telecommunications. The ADA is a companion civil rights legislation of the Civil Rights Act of 1964 and Section 504 of the Rehabilitation Act of 1973. In order to be protected by disability is defined by the ADA as a person who has a physical or mental impairment that substantially limits one or more major life activities, a person who has a history or record of such impairment, or a person who is perceived by others as having such an impairment. The ADA, however, does not specifically name all the impairments that are covered.

The ADA is divided into five sections covering the following topics:

Title I: Employment

Title II: Public Services (and Transportation)

Title III: Public Accommodations (and Commercial Facilities)

Title IV: Telecommunications

Title V: Miscellaneous Provisions

Title II specifically prohibits state and local governments from discrimination against persons with disabilities or from excluding participation in or denying benefits of programs, services, or activities to persons with disabilities. It is under this title that this transition plan has been prepared. This transition plan is intended to outline the methods by which physical changes will be made to give effect to the non-discrimination policies described in Title II.

Transition Plan Development

To ensure program accessibility for person with disability in the community, Boone County has developed a Transition Plan, which is to be considered good practice. This Transition Plan for Public Rights-of-Way considers the following:

ADA Coordinator – Max Mendenhall

Effective communication is essential to address all the complaints or concerns of all individuals. In order to keep the lines of communication open, and thereby ensuring effective communication between all parties, Boone County has designated the Director of Capital Investments as the ADA Coordinator. The ADA Coordinator shall coordinate the Community's efforts to comply with and carry out its responsibilities under Title II of the ADA, including investigations of any complaint communicated to the ADA Coordinator. Such complaints may take the form of alleging noncompliance with ADA mandates or alleging any actions that would be prohibited under the ADA. Boone County shall make available to all interested individuals the name, office address, email address, and telephone number of the employee so designated and shall adopt any public procedures for the prompt and equitable resolution of complaints. Every complaint must be directed in writing to the ADA Coordinator, in this case, Max Mendenhall, Director of Capital Investments.

Grievance Procedure:

The Grievance Procedure established below is intended to adhere to the standards outlined in the ADA. The procedure must be used by anyone who wishes to file a complaint alleging discrimination on the basis of disability in the provisions of services, activities, programs, or benefits by Boone County.

The complaint should be in writing and contain grievant information such as name, address, phone number, email address of complainant and location, date, and description of the problem about the alleged discrimination. Grievance Forms must be used to lodge a complaint, please refer to Appendix A. Alternative means of filing complaints, such as personal interviews or recording of the complaint will be made available for persons with disabilities upon request. The complaint should be submitted by the grievant and/or their designee as soon as possible but no later than 180 days after the alleged violation to:

Max Mendenhall, Director of Capital Investments
127 West Main Street
Suite 306
Lebanon, IN 46052

Within 15 calendar days after receipt of the complaint, the ADA Coordinator or their designee will meet with the grievant to discuss the complaint and the possible resolutions. Within 15 calendar days of the meeting, the ADA Coordinator or their designee will respond in writing, and where appropriate, in a format accessible to the grievant, such as large print, Braille, or audio tape. The response will explain the position of Boone County and offer options for substantive resolution of the complaint.

If the response by the ADA Coordinator or their designee does not satisfactorily resolve the issue, the grievant or their designee may appeal the decision within 15 calendar days after receipt of the response to the County Board of Commissioners. Within 15 calendar days after receipt of the appeal, the County Board of Commissioners will meet with the grievant to discuss the appeal and possible resolutions. Within 15 calendar days after the meeting, the County Board of Commissioners will respond in writing, and, where appropriate, in a format described above that is accessible to the grievant, with a final resolution of the complaint.

All written complaints received by the ADA Coordinator or their designee, appeals to the County Board of Commissioners, and responses from the ADA office will be retained by Boone County for at least three (3) years.

Self-Evaluation

As reflected, an inventory of current Boone County owned and maintained public sidewalks, crosswalk, and public areas has been conducted to ensure compliance with federal Public Rights-of-Way Accessibility guidelines (PROWAG) together

with the Indiana Department of Transportation (INDOT) Design guidelines, standard drawings, and standard specifications will provide the key standards and guidelines for this plan.

ADA Standards, Specifications, and Design Details

Boone County will implement all INDOT curb ramp design standards that can be found under Appendix F: INDOT Design Standards to ensure that all curb ramps will have proper ADA accessibility. Boone County will also follow the Americans with Disabilities Act Accessibility Guidelines (ADAAG) which can be found here <https://www.ada.gov/regs2010/2010ADAStandards/2010ADASTandards.htm> .

Implementation

Boone County intends to implement this Transition Plan effective the date of this document. Not only does Boone County commit to the following the guidelines set forth in this Transition Plan, but it also commits to actively revising and amending this document as new information is discovered. ADA Non-Compliance/Barriers will be addressed within future project limits.

APPENDIX A

Grievance Form

Complaint / Grievance Form**Grievant Information:**

Grievant Name:			
Address:	City:	State:	Zip Code:
Phone:	E-Mail:		
Alternative Phone:			

Person Preparing Complaint Relationship to Grievant (if different from Grievant):

Grievant Name:			
Address:	City:	State:	Zip Code:
Phone:	E-Mail:		
Alternative Phone:			

Please specify any location(s) related to the complaint or grievance (if applicable):

Please provide a complete description of the specific complaint or grievance:

Please state what you think should be done to resolve the complaint or grievance:

Please attach additional pages as needed.

Signature: _____

Date: _____

Please return to Max Mendenhall, ADA Coordinator for Boone County, 127 West Main Street, Suite 306, Lebanon, IN 46052 or send it via email to facilities@co.boone.in.us

Upon request, reasonable accommodation will be provided in completing this form or copies of the form will be provided in alternative formats. Contact the ADA Coordinator at 127 W. Main St. Suite 306 Lebanon, IN 46052, via email at facilities@co.boone.in.us, or via telephone (765) 483-5242.

APPENDIX B

Inventory of Outdoor Barriers

Center Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Marion Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Clinton Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Washington Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Sugar Creek Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Jefferson Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Jackson Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Harrison Township Table

Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Worth Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Lyn Lea	Lyn Lea Ln & E 100 S	W	Curb Ramp	curb crosses sidewalk - no way for people to cross the street	Construct curb ramp	PROWAG	
	Lyn Lea	Lyn Lea Ln & E 100 S	E	Curb Ramp	sidewalk leads into driveway	Construct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Blackstone	Blackstone Blvd & Oak St	NE	Curb Ramp	curb does not have an indent for where the sidewalk crosses - people unable to cross the street	Reconstruct curb ramp	PROWAG	
	Blackstone	Blackstone Blvd & Oak St	NW	Curb Ramp	curb does not have an indent for where the sidewalk crosses - people unable to cross the street	Reconstruct curb ramp	PROWAG	
	Blackstone	Blackstone Blvd	E Median	Curb Ramp	new curb ramp but cross slope does not meet requirements	Reconstruct curb ramp	PROWAG	
	Blackstone	Blackstone Blvd	W Median	Curb Ramp	new curb ramp but cross slope does not meet requirements	Reconstruct curb ramp	PROWAG	
	Blackstone	Independence Dr & Blackstone Dr	S	Curb Ramp	new curb ramp but cross slope does not meet requirements	Reconstruct curb ramp	PROWAG	
	Blackstone	Patriot Ct & Blackstone Dr	S	Curb Ramp	new curb ramp but cross slope does not meet requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Whitestown Pkwy	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr (6857)	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr (6857)	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr (6866)	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr (6866)	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr ("horseshoe" drive - south)	SW	Curb Ramp	cross slope does not meet ADA requirements - in driveway	Reconstruct drive to meet ADA slope	PROWAG	
	Stonegate	Stonegate Dr ("horseshoe" drive - south)	NW	Curb Ramp	No detectable warning surface - in driveway	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr ("horseshoe" drive - north)	SW	Curb Ramp	cross slope does not meet ADA requirements - in driveway	Reconstruct drive to meet ADA slope	PROWAG	
	Stonegate	Stonegate Dr ("horseshoe" drive - north)	NW	Curb Ramp	No detectable warning surface - in driveway	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Elementry School drive (south)	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Elementry School drive (south)	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Elementry School drive (north)	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Elementry School drive (north)	NW	Curb Ramp	ramp slope does not meet ADA requirements - pavement also needs patching	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Regents Park Dr	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Regents Park Dr	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Regents Park Dr	SW	Curb Ramp	ramp and cross slope do not meet ADA requirements	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Stonegate	Stonegate Dr & Regents Park Dr	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Beekman Terrace	NE	Curb Ramp	ramp and cross slope do not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Beekman Terrace	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Beekman Terrace	SW	Curb Ramp	no curb ramp - potential for new curb ramp to be built	Construct new curb ramp	PROWAG	
	Stonegate	Beekman Pl W & Regents Park Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl W & Regents Park Dr	NE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl W & Regents Park Dr	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl W & Regents Park Dr	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl W (cul-de-sac)	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl W (cul-de-sac)	SE	Curb Ramp	No detectable warning surface - pavement around curb needs patching	Retrofit DWS	PROWAG	
	Stonegate	Regents Park Dr & Bishops Grn	NE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Bishops Grn	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr	N	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr	S	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Bishops Grn & Chapel Crossing	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Bishops Grn & Chapel Crossing	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Bishops Grn & Chapel Crossing	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Chappel Crossing & Chappel X-ing	NW	Curb Ramp	No detectable warning surface - in driveway	Retrofit DWS	PROWAG	
	Stonegate	Chappel Crossing & Chappel X-ing	SW	Curb Ramp	cross slope does not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Chappel Crossing & Chappel X-ing	NW	Curb Ramp	No detectable warning surface - in driveway	Retrofit DWS	PROWAG	
	Stonegate	Chappel Crossing & Chappel X-ing	SW	Curb Ramp	ramp slope does not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Chappel Crossing & Carriage House Way	E	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Carriage House Way (immediately east of cul-de-sac)	N	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Carriage House Way (immediately east of cul-de-sac)	S	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Carriage House Way & Jons Station	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Carriage House Way & Jons Station	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Carriage House Way & Jons Station	SW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Carriage House Way & Jons Station	SE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Jons Station & Bishops Grn	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Jons Station & Bishops Grn	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Stonegate	Jons Station & Bishops Grn	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Jons Station & Bishops Grn	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Bishops Grn	NW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Bishops Grn	NE	Curb Ramp	not found - part of driveway with no real curb ramp	No action required	PROWAG	
	Stonegate	Stonegate Dr & Bishops Grn	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Bishops Grn	SE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Carriage House Way	NW	Curb Ramp	ramp slope does not meet ADA requirements - needs pavement patching	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Carriage House Way	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Carriage House Way	SW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Carriage House Way	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Stonegate Ln	W	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Stonegate Ln	E	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Chapple Crossing & Chapple Crossing	SE	Curb Ramp	ramp slope does not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Chapple Crossing & Chapple Crossing	S Median	Curb Ramp	potential retrofit - in driveway	Retrofit DWS	PROWAG	
	Stonegate	Chapple Crossing & Chapple Crossing	N Median	Curb Ramp	ramp and cross slope do not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Chapple Crossing & Chapple Crossing	NE	Curb Ramp	ramp slope does not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Chapple Crossing & Stonegate Dr	NW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Chapple Crossing & Stonegate Dr	NE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Chapple Crossing & Stonegate Dr	SW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Chapple Crossing & Stonegate Dr	SE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Beekman Pl	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Beekman Pl	NE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Beekman Pl	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Beekman Pl	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl & Beekman Terrace	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl & Beekman Terrace	SW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl & Beekman Terrace	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Pl & Beekman Terrace	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Terrace & Westminster Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Terrace & Westminster Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Stonegate	Beekman Terrace & Westminster Dr	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Beekman Terrace & Westminster Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Westminster Dr	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Westminster Dr	NE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	Stonegate Dr & Westminster Dr	SW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Stonegate Dr & Westminster Dr	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Westminster Dr	NW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Westminster Dr	NE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Westminster Dr	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Regents Park Dr	SE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Regents Park Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Regents Park Dr	NE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Regents Park Dr	SW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Regents Park Dr	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Elementry School	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Elementry School	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Elementry School	W	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Regents Park Dr & Elementry School	E	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cums & Windsor Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cums & Windsor Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cums & Windsor Dr	SW	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cums & Windsor Dr	SE	Curb Ramp	potential retrofit	Retrofit DWS	PROWAG	
	Stonegate	The Cums & Dead End	SE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Windsor Dr	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Windsor Dr	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Regents Park Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements - pavement needs patching around curb	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Regents Park Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Regents Park Dr	SW	Curb Ramp	potential retrofit - pavement needs patching around curb	Reconstruct curb ramp	PROWAG	
	Stonegate	Windsor Dr & Regents Park Dr	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Stonegate	Regents Park Dr & Westminster Dr	NE	Curb Ramp	meets all ADA requirements - curb is higher than ramp	Reconstruct curb to match ramp	PROWAG	
	Stonegate	Regents Park Dr & Westminster Dr	SE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Westminster Dr & Cambridge Lane	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Westminster Dr & Cambridge Lane	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Westminster Dr & Cambridge Lane	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	S Median	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Deerfield Dr & Cambridge Lane	N Median	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Deerfield Dr & Deerfield Ln	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements - in driveway	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr & Deerfield Ln	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	Deerfield Dr & Deerfield Ln	SE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr	S Median	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr	N Median	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Ln & Deerfield CT	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	Deerfield Ln & Deerfield CT	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	St. Lawrence Ct & Deerfield Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	St. Lawrence Ct & Deerfield Dr	NE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	St. Lawrence Ct & Deerfield Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	St. Lawrence Ct & Deerfield Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Deerfield Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Deerfield Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Stonegate	The Cmns & Deerfield Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Stonegate	The Cmns & Deerfield Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Royal Run	Abby Ln & E 650 S	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & E 650 S	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	SE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Amherst Way	N Median	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	S Median	Curb Ramp	ramp slope does not meet ADA requirements - part of driveway	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SW Median	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SE Median	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way	SE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way & Abby Ln	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Amherst Way & Abby Ln	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Amherst Way & Abby Ln	SE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	NE	Curb Ramp	extremely cracked and sunken- completely rebuild	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Sussex Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Sussex Dr	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Sussex Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Sussex Dr	S Median	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Sussex Dr	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Sussex Dr	N Median	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Royal Run Blvd	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Abby Ln & Royal Run Blvd	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Royal Run	Saddletree Dr & Royal Run Blvd	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Saddletree Dr & Royal Run Blvd	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Glenwood Trce	SE	Curb Ramp	ccompletely cracked - needs to be replaced	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Royal Run Blvd.	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Saddletree Dr & Royal Run Blvd.	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & Kingsbury Way	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Kingsbury Way	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & S 700 E	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & S 700 E	SE	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Kingsbury Way & Wilshire Pl	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Kingsbury Way & Wilshire Pl	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Kingsbury Way & Wilshire Pl	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Kingsbury Way & Hyde Park Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Kingsbury Way & Hyde Park Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Kingsbury Way & Hyde Park Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Hyde Park Dr & Wilshire Pl	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Hyde Park Dr & Wilshire Pl	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hyde Park Dr & Royal Run Blvd	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hyde Park Dr & Royal Run Blvd	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Stafford Trace	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Stafford Trace	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & Oxford Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Oxford Dr	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Hampshire Dr & Royal Run Blvd	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hampshire Dr & Royal Run Blvd	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Royal Run	Hampshire Dr & Hunters Ridge	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hampshire Dr & Hunters Ridge	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hampshire Dr & Hunters Ridge	SW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hampshire Dr & Hunters Ridge	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Yotkshire Circ & Hunters Ridge	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Yotkshire Circ & Hunters Ridge	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Yotkshire Circ & Hampshire Dr	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Yotkshire Circ & Hampshire Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Yotkshire Circ & Hampshire Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Hunters Ridge & Woodcliff Cir	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Hunters Ridge & Woodcliff Cir	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Hunters Ridge & Woodcliff Cir	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Woodcliff Cir & Royal Run Blvd	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Woodcliff Cir & Royal Run Blvd	SE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Stafford Trace & Royal Run Blvd	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Stafford Trace & Roxbury Pl	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Stafford Trace & Roxbury Pl	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Roxbury Pl & Stafford Trace	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Roxbury Pl & Stafford Trace	SE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Lexington Cir	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lexington Cir & Briargate Dr	NW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lexington Cir & Briargate Dr	SW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lexington Cir & Briargate Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Briargate Dr & Berkshire Dr	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Briargate Dr & Berkshire Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Briargate Dr & Dorchester Dr	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Briargate Dr & Dorchester Dr	SW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Briargate Dr & Dorchester Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lexington Cir & Dorchester Dr	NW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lexington Cir & Dorchester Dr	NE	Curb Ramp	needs to be replaced - no turning space and cracked	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Royal Run	Lexington Cir & Dorchester Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lexington Cir	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr	NW	Curb Ramp	needs to be completely rebuilt - completely cracked	Reconstruct curb ramp	PROWAG	
	Royal Run	Wimbledon Dr & Bradshire Ct	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr & Bradshire Ct	NE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Wimbledon Dr & Bradshire Ct	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Wimbledon Dr & Pickwick Ct	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr & Pickwick Ct	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr & Pickwick Ct	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Wimbledon Dr & Pickwick Ct	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Pickwick Ct & Royal Run Blvd	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Pickwick Ct & Royal Run Blvd	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & Dorchester Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Royal Run Blvd & Dorchester Dr	SE	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Lancaster Pl	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Royal Run Blvd & Lancaster Pl	NE	Curb Ramp	needs to be completely rebuilt - asphalt acting as curb ramp	Reconstruct curb ramp	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	NW	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	NE	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	SW	Curb Ramp	ramp and cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lancaster Pl & Canterbury Dr	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lancaster Pl & Royal Run Blvd	NE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Lancaster Pl & Royal Run Blvd	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Royal Run	Berkshire Dr & Lexington Cir	E	Curb Ramp	cross slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	
	Royal Run	Berkshire Dr & Lexington Cir	NW	Curb Ramp	needs to be completely rebuilt - no turning space	Reconstruct curb ramp	PROWAG	
	Royal Run	Berkshire Dr & Lexington Cir	SW	Curb Ramp	ramp slope does not meet ADA requirements	Reconstruct curb ramp	PROWAG	

Eagle Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Lexington Hall	Beck Ln	SE	Curb Ramp	cross slope does not meet ADA requirements - curb ramp goes nowhere	Reconstruct when north side develops	PROWAG	
	Lexington Hall	Beck Ln	NE	Curb Ramp	no sidewalk or curb ramp	Add curb ramp & SW when	PROWAG	
	Cheval de Selle	Cheval Rue Ct & Salem Rd	N	Curb Ramp	sidewalk ends in the grass, no curb ramp or way to cross the street	Add SW when area develops	PROWAG	
	Cheval de Selle	Cheval Rue Ct & Salem Rd	N Median	Curb Ramp	nothing in median to allow people to cross the street	Add median x-ing when SW is	PROWAG	
	Cheval de Selle	Cheval Rue Ct & Salem Rd	S Median	Curb Ramp	nothing in median to allow people to cross the street	Add median x-ing when SW is	PROWAG	
	Cheval de Selle	Cheval Rue Ct & Salem Rd	S	Curb Ramp	sidewalk ends in the grass, no curb ramp or way to cross the street	Add SW when area develops	PROWAG	
	Deer Ridge	Deer Ridge Drive	S	Sidewalk	Sidewalk begins at 950 E and ends at White Tail Cir. Sidewalk does not outlet to street and there is no receiving sidewalk on other side of intersection. Sidewalk is in good condition.	No action required	PROWAG	

Perry Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Saratoga	Snaffle Bit Rd & 400 S	NW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Saratoga	Snaffle Bit Rd & 400 S	NE	Curb Ramp	there is no curb ramp - sidewalk does not reach end of road	Extend SW and construct curb ramp	PROWAG	
	Saratoga	Snaffle Bit Rd & Paddock Rd	NW	Curb Ramp	cross slope does not meet requirements and TS not large enough	Reconstruct curb ramp	PROWAG	
	Saratoga	Snaffle Bit Rd & Paddock Rd	NE	Curb Ramp	No detectable warning surface - attached to someones drive	Retrofit DWS	PROWAG	
	Saratoga	Snaffle Bit Rd & Paddock Rd	SW	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	
	Saratoga	Snaffle Bit Rd & Paddock Rd	SE	Curb Ramp	No detectable warning surface	Retrofit DWS	PROWAG	

Union Township Table								
Label	Subdivision	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Pleasantview	Pleasantview Ln & 975 E	NW	Curb Ramp	no curb ramp attached to sidewalk - to be built	No action required at this time	PROWAG	
	Pleasantview	Pleasantview Ln & median	NE	Curb Ramp	all stone for sidewalk - no real curb ramp - cross and ramp slope do not met requirements	Reconstruct curb ramp	PROWAG	
	Pleasantview	Pleasantview Ln & median	SE	Curb Ramp	all stone for sidewalk - no real curb ramp - cross and ramp slope do not met requirements	Reconstruct curb ramp	PROWAG	
	Pleasantview	Pleasantview Ln & median	NW	Curb Ramp	all stone for sidewalk - no real curb ramp - cross and ramp slope do not met requirements	Reconstruct curb ramp	PROWAG	
	Pleasantview	Pleasantview Ln & median	SW	Curb Ramp	all stone for sidewalk - no real curb ramp - cross and ramp slope do not met requirements	Reconstruct curb ramp	PROWAG	
	Pleasantview	Pleasantview Ln	SE	Curb Ramp	no sidewalk / curb ramp yet due to undeveloped land	SW & curb ramp to be built when developed	PROWAG	
	Pleasantview	Pleasantview Ln	NE	Curb Ramp	no sidewalk / curb ramp yet due to undeveloped land	SW & curb ramp to be built when developed	PROWAG	
	Pleasantview	Pleasantview Ln	SE	Curb Ramp	no sidewalk / curb ramp yet due to undeveloped land	SW & curb ramp to be built when developed	PROWAG	
	Pleasantview	Pleasantview Ln & 975 E	N Median	Curb Ramp	all brick median - sidewalk on both sides most likely never met median due to undeveloped land	SW & curb ramp to be built when developed	PROWAG	
	Pleasantview	Pleasantview Ln & 975 E	S Median	Curb Ramp	all brick median - sidewalk on both sides most likely never met median due to undeveloped land	SW & curb ramp to be built when developed	PROWAG	

APPENDIX C

Inventory of Indoor Barriers

Boone County Sheriff's Office

Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Sheriff's Office	Parking Lot	Parking spaces	does not have enough ADA spots - 4 ADA spots required (1 van)	Will be resolved with jail renovation		
	Sheriff's Office	Sidewalk	Sidewalk from handicap spot	ramp slope does not meet ADA standards	Will be resolved with jail renovation		
	Sheriff's Office	Men's Restroom	Toilet	Toilet is too close to wall	Will be resolved with jail renovation		
	Sheriff's Office	Men's Restroom	Paper Towel Dispenser	paper towel dispenser is too high on wall	Will be resolved with jail renovation		

Boone County Fairgrounds

Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions

Boone County Highway Department

Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Highway Department	Parking Lot	ADA parking spots	not enough ADA parking spots in lot - 2 ADA spots required (1 van)			
	Highway Department	Main Entrance	Main entrance into building	not large enough clearance on handle side of door			

Boone County Prosecutor's Office

Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions





Boone County Key Bank Building							
Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Key Bank Building	3rd Floor	Double Door Hallway Entrance	Not large enough opening for ADA access between doors			
	Key Bank Building	3rd Floor	Women's Restroom	turning space in ADA stall not large enough, no ADA sink			
	Key Bank Building	Elevator	Elevator Dimensions	elevator is not deep enough			
	Key Bank Building	Main Entrance	Main entrance double door	needs to provide automatic door openers			
	Key Bank Building	Parking Lot	ADA parking spts	not enough ADA parking spots - 2 ADA spots required (1 van)			
	Key Bank Building	3rd Floor	Men's Restroom	toilet is too far away from wall and there is no grab bar behind toilet			
	Key Bank Building	3rd Floor	Men's Restroom	turning space in ADA stall is too small, no ADA sink			

Boone County Courthouse							
Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	Courthouse	E Main St Entrance	ADA entrance ramp	Ramp slope and landing pad does not meet slope requirements			
	Courthouse	Meridian St Entrance	ADA entrance ramp	Button to gain access is places too high			
	Courthouse	First Floor	Women's Restroom	not large enough turning space, no clear space on side of door			
	Courthouse	First Floor	Men's Restroom	not large enough turning space, no clear space on side of door			
	Courthouse	Third Floor	Women's Restroom	not large enough turning space			
	Courthouse	Basement	Women's Restroom	not large enough turning space, no clear space on side of door			
	Courthouse	Elevator	Elevator Dimensions	elevator dimensions are too small			
	Courthouse	Third Floor	Men's Restroom	toilet is too far away from wall, turning space is too small			
	Courthouse	Basement	Men's Restroom	toilet is too close to wall, paper towel dispenser too high			

Boone County Annex							
Label	Facility Name	Area	Description	Problem	Recommended Correction	Criteria	Finished Actions
	County Annex	Parking Lot	Curb ramp to parking lot	ramp slope does not meet requirements			
	County Annex	Men's Restroom	Paper Towel Dispenser	paper towel dispenser is too high			

APPENDIX D

Sample Photos of Outdoor Barriers

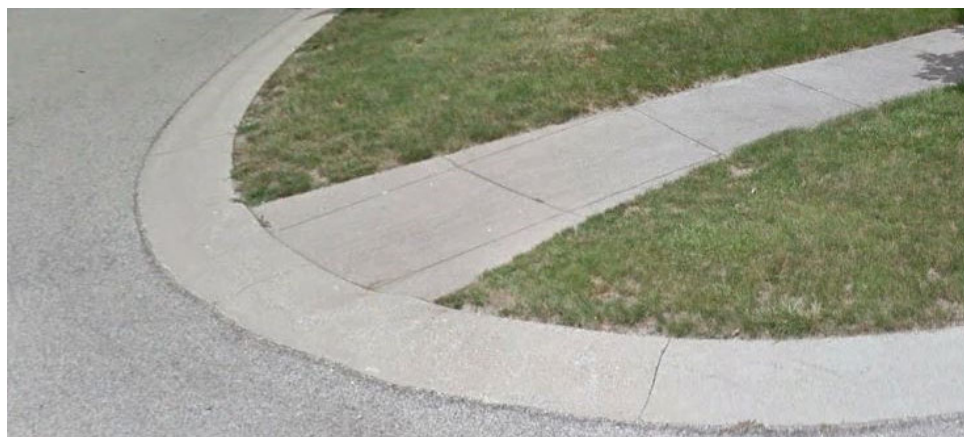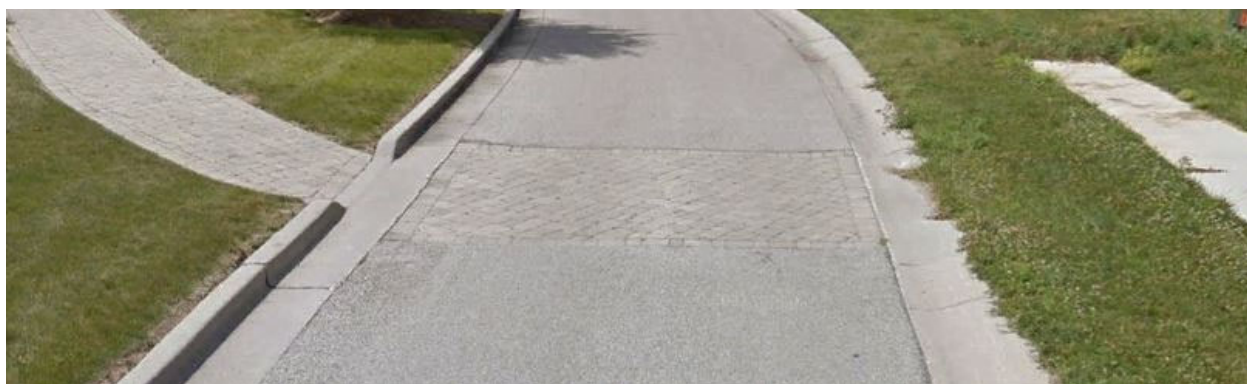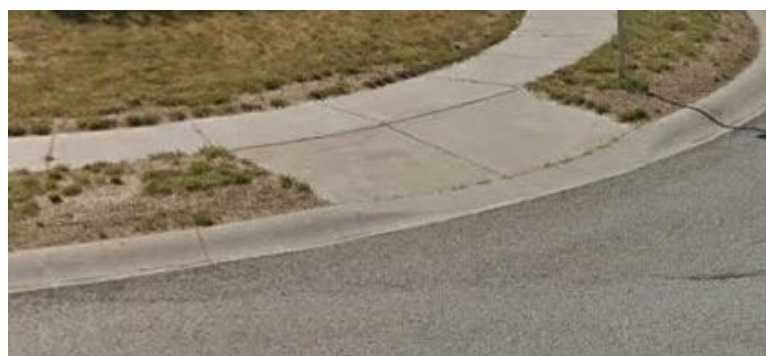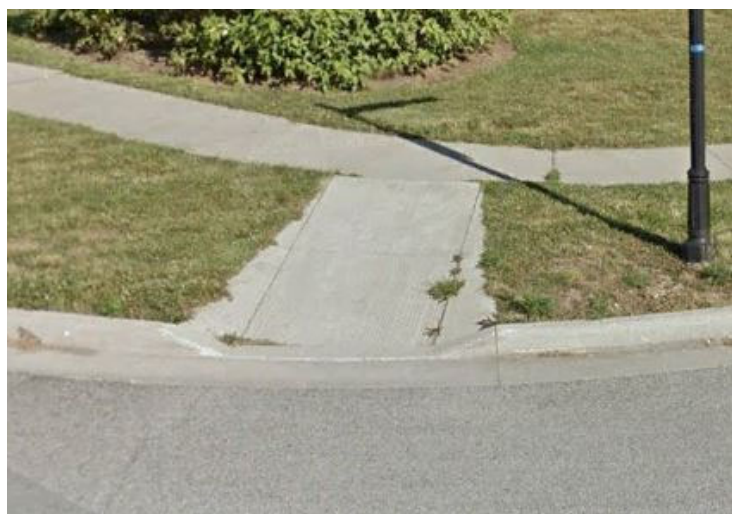

APPENDIX E


Sample Photos of Indoor Barriers



APPENDIX F

INDOT Curb Ramp Standards

INDOT has adopted and implemented design standards consistent with the Public Right-of-way Accessibility Guidelines (PROWAG). Even though the PROWAG has not become law, it has been adopted by and recommended as “best practices” by the Federal Highway Administration (FHWA). INDOT, upon recommendation of the FHWA, has developed and implemented these standards which can be found here <http://www.in.gov/dot/div/contracts/standards/>.

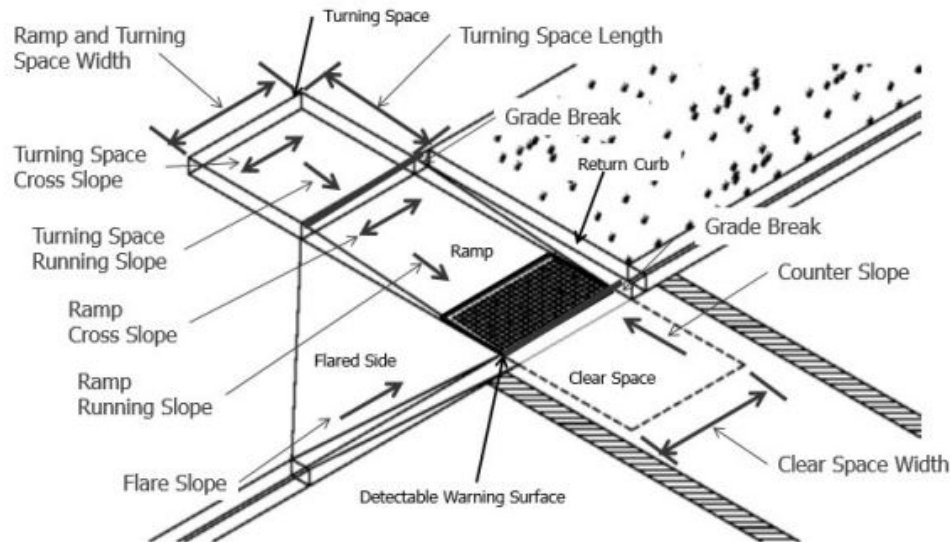

Turning Space must be level with both running and cross slopes $<2.0\%$, meaning these slopes should be designed at $<1.5\%$ to ensure a complaint result.

Running slope of a ramp may not exceed 8.33% and should be designed to less than 8% to ensure a complaint result.

Return Curbs cannot be utilized where there is a paved / walkable surface adjacent to the ramp that would result in a tripping hazard being created by the return curb. Instead, a flared side, not to exceed 10% flare slope, should be installed.

Detectable warnings surface (DWS) is placed at the base of a ramp to indicate to a pedestrian that they are about to cross a street. These warnings must be $24''$ ($2'$) deep in the direction of travel and must cover the entire ramp, unless brick pavers are used, in which case there may be $2''$ border on either side of the detectable warning to secure the bricks.

The counter slope must not create a tipping or tripping hazard to pedestrian entering or exiting the street and the transition to the street at the curb should be flush and must not exceed a $1/2''$ “lip” if beveled or $1/4''$ if not beveled.